


réduction électrosoudable

reducción electrofusión

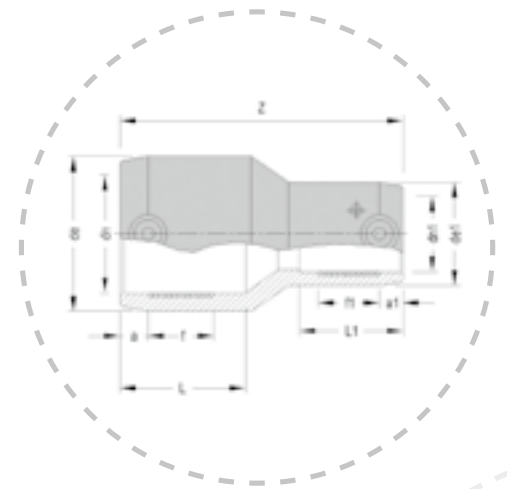

cod. 21.51 PE 100

diam. d _n	SOUDABILITÉ sur tube/raccord SOLDABILIDAD en el tubo/accesorio				
	SDR 17 - S8		SDR 11 - S5		SDR 9 - S4
	PE 80	PE 100	PE 80	PE 100	PE 80
32x 20			● ▲	● ▲	● ▲
32x 25			● ▲	● ▲	●
40x 20			● ▲	● ▲	● ▲
40x 25			● ▲	● ▲	● ▲
40x 32	● ▲	● ▲	●	●	●
50x 25	● ▲	● ▲	●	●	●
50x 32	● ▲	● ▲	●	●	●
50x 40	● ▲	● ▲	●	●	●
63x 32	● ▲	● ▲	●	●	●
63x 40	● ▲	● ▲	●	●	●
63x 50	● ▲	● ▲	●	●	●
75x 63			●	●	●
90x 50	● ▲	● ▲	●	●	●
90x 63	●	●	●	●	●
90x 75	●	●	●	●	●
110x 63			●	●	●
110x 90	●	●	●	●	●
125x 90	●	●	●	●	●
125x 110	●	●	●	●	●
160x 90	●	●	●	●	●
160x 110	●	●	●	●	●
160x 125	●	●	●	●	●

● soudable seulement avec soudeuses monovalentes Serie Euro
soldable solo con máquinas monovalentes Serie Euro

▲ épaisseur minimale soudable 3 mm
espesor mínimo para soldar 3 mm

d _n d _{n1}	dimension - <i>dimensión</i>										poids- <i>peso</i>
	d _e	d _{e1}	L	L ₁	f	f ₁	a	a ₁	Z	PE 100	
										PN16 - S5	
32x 20	44	32	46	38	34	22	10	10	105	75	
32x 25	45	36	44	45	31	21	10	10	103	75	
40x 20	55	33	49	39	27	22	11	10	120	105	
40x 25	55	36	48	40	27	21	11	10	114	100	
40x 32	55	44	54	50	30	29	11	10	109	100	
50x 25	67	37	49	40	27	21	12	10	126	140	
50x 32	66	44	53	49	30	29	12	10	121	170	
50x 40	66	54	55	54	33	33	12	11	119	200	
63x 32	81	46	62	44	31	24	15	12	156	245	
63x 40	81	54	63	54	29	20	15	13	137	250	
63x 50	81	66	62	54	26	23	16	16	131	250	
75x 63	97	81	75	62	34	33	13	13	160	395	
90x 50	117	66	79	55	45	25	18	16	185	555	
90x 63	115	81	77	62	45	33	15	13	160	515	
90x 75	115	97	81	60	39	30	18	18	159	550	
110x 63	144	83	79	63	40	33	20	15	201	905	
110x 90	141	115	87	77	41	39	19	18	181	860	
125x 90	162	118	78	68	42	34	22	17	177	1100	
125x110	162	144	79	73	33	36	22	20	164	1225	
160x 90	209	119	90	79	50	50	23	17	233	2130	
160x110	208	144	95	82	48	37	25	20	218	2400	
160x125	208	162	98	87	47	30	26	21	208	2505	



**raccords
électro-
soudables
accesorios
electro-
soldables**

**soudabilité
garantie sur tubes
en PE80 et PE100**

**soldabilidad
garantizada para
tubería PE 80
e PE 100**

**ABSOLUMENT
obligatoire l'emploi
de positionneur pour
tous les diamètres**

**ABSOLUTAMENTE
obligatorio utilizar
alineador para todos
los diametros**

**ABSOLUMENT
obligatoire le raclage
du tubes**

**ABSOLUTAMENTE
obligatoria
la raspadura
de tubos**